


10407910	DATA SHEET
Valid from: 02.10.2018	POWER H-S 4+2xPE SAS

Description

- Power inserts
- Fast and easy assembly
- Very high current transfer
- Lower space requirement
- Axial screw termination for assembly without special tool

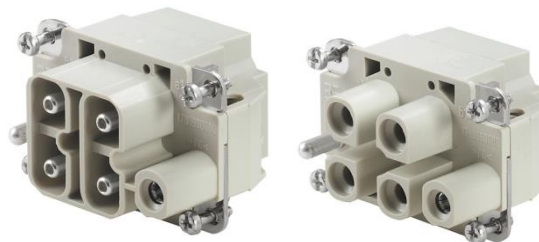

General Characteristics

Series	H-S 4+2xPE
Version	Male (10407900)/Female (10407900)
Number of Contacts	4 + 2x PE
Power-Termination	Axial screw termination: 2,5 - 6 mm ² (AWG 14 - 11) Tightening torque: 1,1 Nm - 1,7 Nm
PE-Termination	Screw termination: 2,5 - 6 mm ² (AWG 14 - 11) Tightening torque: 0,5 Nm - 0,8 Nm
Temperature Range	-40°C to +125°C

Mechanical Characteristics

Cycle of mechanical operation	500
-------------------------------	-----

Electrical Characteristics


Rated Voltage	1000 V
Rated Impulse Voltage	8 kV
Rated Current	40 A
Contact Resistance	< 1 mOhm
Degree of Soiling	3

Material/Surface


Insulation body	PC glass-fibre reinforced
Contacts	Brass
Contact surface	Silver passivated

10407910	DATA SHEET
Valid from: 02.10.2018	POWER H-S 4+2xPE SAS

Technical Drawing

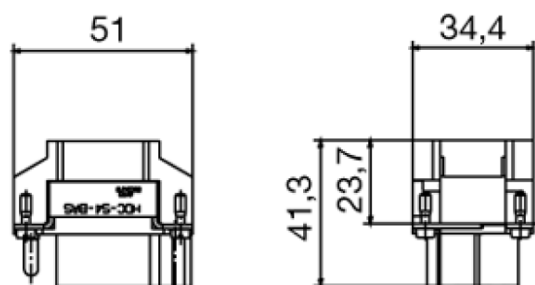


Male

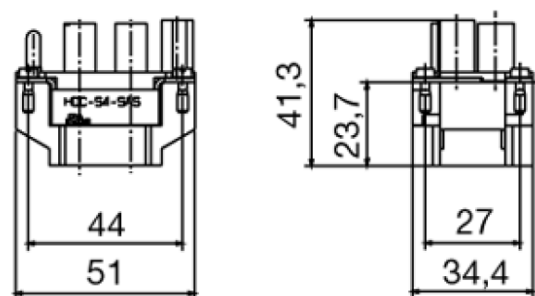

Female

Mounting instructions

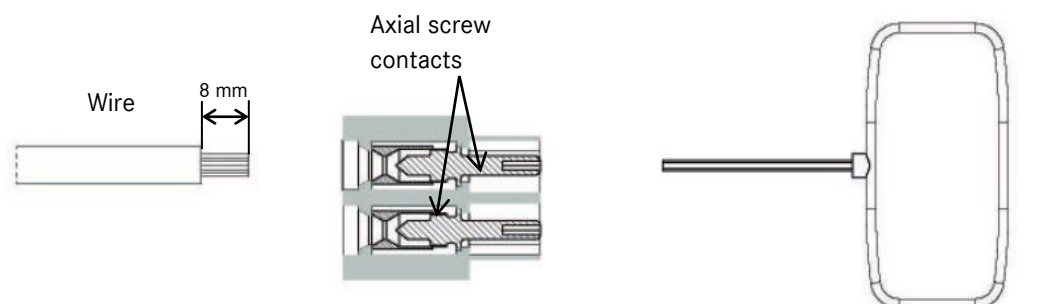

1. Stripp the wire, stripping length: 8 mm. Please do not twist the stranded wire.
2. Push the stranded wire into the contact chamber until the insulation is flush with the contact.
3. On the mating face side, insert the hex key (Art. No. 44424028) into the contact
4. When tightening the clamping nut, please hold the strands in position.

Tightening torque between 1.1 Nm and 1.7 Nm.

10407910	DATA SHEET
Valid from: 02.10.2018	POWER H-S 4+2xPE SAS



Wide clamping range



Industrial machinery and plant engineering



Temperature-resistant

Info

Very high current transfer in a small space
Axial screw termination for assembly without special tool

Application range

Mechanical engineering
Plant engineering
Renewable energy

Remark

Photographs are not to scale and do not represent detailed images of the respective products.